

Magna L100: Heat Resistant


Magna L100 has a heat resistance of 80 ° C, which is similar to ABS's performance and appearance. It has excellent corrosion resistance for various solvents and oils. The excellent temperature resistance makes the Magna L100 suitable for a wider range of applications, including luminaires and automotive interiors. After the forming, the surface texture is smooth and fine, and only a very short post-processing is required, which greatly reduces the production period of the hand model.

Advantages

- High temperature resistance
- Excellent detail and surface texture
- Easy to make and post-process

Applications

- Automobile industry
- High temperature model making
- Wind tunnel test
- Electronics housing
- Dental orthodontics
- Lighting production

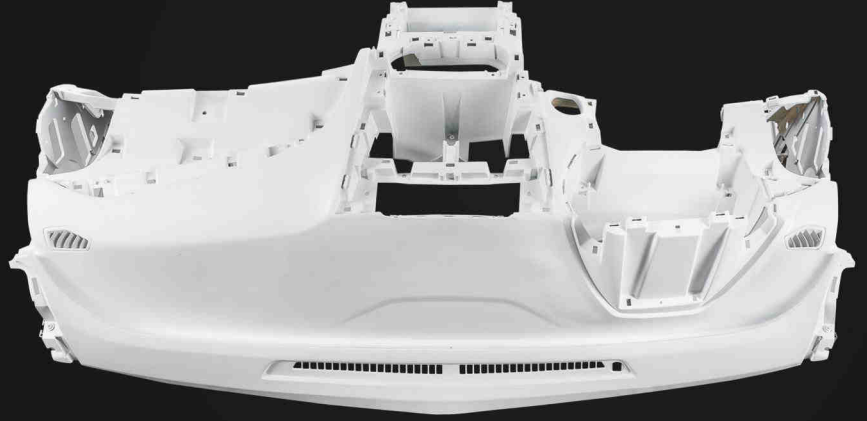

Magna L100 HIGH TEMPERATURE Series

Liquid Properties			Optical Properties		
Appearance	White (Customizable)		Ec	10.1-10.9 mJ/cm ²	[critical exposure]
Viscosity	350-410 cps	@ 25°C	Dp	0.14~0.16 mm	[slope of cure-depth vs. ln(E) curve]
Density	1.145 g/cm ³	@ 25°C			

Mechanical Properties (90 Minutes UV Postcure)		
ASTM Method	Property Description	Value
ASTM D 638	Tensile Modulus	2385-2896 MPa
ASTM D 638	Tensile Strength at Break	56-61 MPa
ASTM D 638	Elongation at Break	4-8%
ASTM D 648 @66PSI	Heat Deflection Temperature	75-80°C
ASTM D 790	Flexural Strength	81-89 Mpa
ASTM D 790	Flexural Modulus	2815-2875 Mpa
ASTM D 256	Izod Impact (Notched)	20~30 J/m
ASTM D 2240	Hardness Shore D	82-86

These values may vary and depend on individual machine processing and post-curing practices.

PROTOFAB

Photoreactive Resin

Product Name :
SKU# :
Weight : 10KGS
Date of Manufacturing :
LOT# : 000716ZLAR
Sealed and Stored in Dry Place at Room Temperature

Warning



1. Skin can be irritated, skin should be taken care of after work handling
2. Touching the resin can cause irritation of the skin
3. Contact with eyes is likely to cause severe irritation
4. Accidental injection is extremely serious. If resin comes into contact with hands, do not touch the mouth or face
5. Liquid resin is extremely harmful to aquatic life, causing long-term damage
6. Avoid breathing in any dust / smoke/particles/resins originating from the resin
7. Wash hands thoroughly after operation
8. Contaminated clothing should not be worn outside the working area. Always steam correctly and do not reuse. Quaternary salt cause significant environmental damage
9. Always wear protective gloves, goggles and bonnet when operating
10. If swallowed seek immediate medical assistance
11. If resin comes into contact with skin, wash thoroughly with soap, preferably in a shower
12. If there are signs of irritation or a rash seek medical assistance
13. If there are signs of irritation, the eyes wash with water for several minutes. After an initial period of washing, those wearing contact lenses should carefully take them out and wash the eyes with the lenses removed
14. If the eyes are still irritated after washing seek medical assistance
15. Waste resin requires treatment from an approved waste treatment plant



PROTOFAB
BEYOND DIMENSIONS

PROTOFAB™
BEYOND DIMENSIONS

P : +86-592-3862946 F : +86-592-3862808 E : info@3dprotofab.com 899 Maqing Road, Haicang District, Xiamen, Fujian, China 361026

Powered by Vistar (Xiamen) Industries CO., Ltd.



Please visit us online:
www.3dprotofab.com